

Application-Specific Information

PID6-603e_N PNS 980521 Motorola Part Numbers Affected:

 MPC603ERX100LN
 MPC603ERX133LN

 MPE603ERX100LN
 MPE603ERX133LN

 MPC603EFE100LN
 MPC603EFE133LN

 MPC603EFE100LN
 MPC603EFE133LN

 MPC603ERX100TN
 MPC603ERX133TN

 MPC603EFE133TN

PowerPC 603e™ RISC Microprocessor Family: PID6-603e (Stretch) Part Number Specifications

This document defines a unique part number for a PowerPCTM 603e microprocessor manufactured by Motorola. It describes changes to recommended operating conditions and revised electrical specifications, as applicable, from those described in the PID6-603e $Hardware\ Specification$.

Specifications provided in this data sheet supercede those in Revision 1 (11/96) of the *PID6-603e Hardware Specifications* (order #: MPC603EC/D); specifications not addressed herein are unchanged.

Note that headings and tables in this data sheet are not numbered; however, they are intended to correspond directly to the heading or table affected in the general hardware specifications. Any additional information (including tables) not included in the hardware specifications are noted.

Part numbers addressed in this document and a summary of their differences from the general specification are listed in the following table. For more detailed ordering information see "Ordering Information for the PowerPC 603e" on page 4.Feature Changes

Part Numbers Addressed by this Part Number Specification

	Operating Conditions					
Motorola Part Number	CPU Frequency	Vdd	T _J (°C)	Significant Differences		
MPC603ERX100LN	100 MHz	3.3 V ± 5%	0 to 105	Modified AC spec, BGA package (low frequency operation restricted to 80MHz minimum)		
MPC603ERX133LN	133 MHz	3.3 V ± 5%	0 to 105	Modified AC spec, BGA package (low frequency operation restricted to 120MHz minimum)		
MPC603EFE100LN	100 MHz	3.3 V ± 5%	0 to 105	Modified AC spec, QFP package (Low frequency operation restricted to 80MHz minimum)		
MPC603EFE133LN	133 MHz	3.3 V ± 5%	0 to 105	Modified AC spec, QFP package (low frequency operation restricted to 120MHz minimum)		
MPE603ERX100LN	100 MHZ	3.3 V ± 5%	0 to 105	Modified AC spec, BGA package (floating point not supported, low frequency operation restricted to 80MHz minimum)		
MPE603ERX133LN	133 MHz	3.3 V ± 5%	0 to 105	Modified AC spec, BGA package (floating point not supported, low frequency operation restricted to 120MHz minimum)		
MPE603EFE100LN	100 MHz	3.3 V ± 5%	0 to 105	Modified AC spec, QFP package (floating point not supported, low frequency operation restricted to 80MHz minimum)		
MPE603EFE133LN	133 MHz	3.3 V ± 5%	0 to 105	Modified AC spec, QFP package (floating point not supported, low frequency operation restricted to 120MHz minimum)		
MPC603ERX100TN	100 MHz	3.3 V ± 5%	-40 to 105	Modified thermal spec, extended temperature range, BGA package		
MPC603ERX133TN	133 MHz	3.3 V ± 5%	-40 to 105	Modified thermal spec, extended temperature range, BGA package		

The PowerPC name is a registered trademark and the PowerPC logotype and PowerPC 603e are trademarks of International Busines Machines Corporation, used by Motorola under license from International Business Machines Corporation.

This document contains information on a new product under development by Motorola. Motorola reserves the right to change or discontinue this product without notice.





Part Numbers Addressed by this Part Number Specification (Continued)

Motorola Part	Operating Conditions				
Number	CPU Frequency	Vdd	T _J (°C)	Significant Differences	
MPC603EFE100TN	100 MHz	3.3 V ± 5%	-40 to 105	Modified thermal spec, extended temperature range, QFP package	
MPC603EFE133TN	133 MHz	3.3 V ± 5%	-40 to 105	Modified thermal spec, extended temperature range, QFP package	

Feature Changes

This section summarizes significant feature changes between the revision of the 603e addressed by this document and the previous widely available revision 1.4.1 (XPC603ERXnnnLJ or XPC603EFEnnnLJ where nnn is the core frequency).

This revision fixes numerous errata which existed on the earlier revision but added no new features.

Errata

This section summarizes design defects or errors (errata) that are known to exist on this revision of the 603e. There may be additional errata that are not known or are not yet documented here which may cause the part to deviate from the functional description provided in the *MPC603e* & *EC603e* ** *RISC Microprocessor User's Manual* (order # MPC603EUM/AD Rev 1). Refer to the website at http://www.mot.com/SPS/PowerPC/ for the latest version of this Part Number Specification or to your local Motorola sales office for later and/or more detailed description of the errata.

The known errata as of the date of this document are summarized below.

#	Problem	Description	Impact	Solutions
1	Snoop causes cancelled speculative load to corrupt GPR/FPR.	A snoop that hits to a pending but cancelled copy back address can cause wrong data to be loaded into a GPR/FPR.	All systems that use hard- ware coherency along with speculative loads.	Set G=1 to pages loaded from during snooping.
2	Snoop copyback causes every tenth dcbi to fail.	A snoop which causes a copyback and occurring in a one cycle window near every tenth dcbi causes the dcbi to fail to invalidate the cache.	Only systems using both software and hardware coherency simultaneously are affected.	After each dcbi, place an additional dcbi to the same address.

Electrical and Thermal Characteristics

This section provides any changes to the AC and DC electrical specifications and thermal characteristics for the PID6-603e parts described herein.

DC Electrical Characteristics

The following table describes the changed thermal operating conditions for the PID6-603e part numbers described herein.

Recommended Operating Conditions

Characteristic	Symbol	Value	Unit	Notes
Junction temperature	Tj	-40 to 105	°C	1

Note: 1. Parts with TN suffix only.

AC Electrical Characteristics

The AC timing specifications described in the *PID6-603e Hardware Specifications* include 100MHz, 120MHz, and 133MHz. Motorola has discontinued the 120MHz offering for the revision described herein. Customers desiring to operate at 120MHz are encouraged to purchase the 133MHz part. This section provides any other AC electrical characteristics that have been changed for this revision.

Clock AC Specifications

The following table provides the revised clock AC timing specifications for the parts described herein

Note that the minimum core frequency has been raised from the 16.67MHz value in the Hardware Specification to 80MHz. Some parts of this revision manufactured recently will not operate that slowly.

Clock AC Timing Specifications

Vdd = AVdd = $3.3 \pm 5\%$ V dc, OVdd = $3.3 \pm 5\%$ V dc, GND = 0 V dc, $0 \le T_i \le 105$ °C

Num	Characteristic	100 MHz		133.33 MHz		1114	Natas
	Characteristic	Min	Max	Min	Max	Unit	Notes
	Processor frequency	80	100	120	133.33	MHz	1
	VCO frequency	100	200	133.33	266.66	MHz	1
	SYSCLK (bus) frequency	16.67	66.67	16.67	66.67	MHz	
1	SYSCLK cycle time	15.0	60.0	15.0	60.0	ns	
2,3	SYSCLK rise and fall time	_	2.0	_	2.0	ns	2
4	SYSCLK duty cycle measured at 1.4 V	40.0	60.0	40.0	60.0	%	3
	SYSCLK jitter	_	±150	_	±150	ps	4
	Internal PLL relock time	_	100	_	100	μS	3, 5

Notes:


- Caution: The SYSCLK frequency and PLL_CFG[0-3] settings must be chosen such that the resulting SYSCLK (bus) frequency, CPU (core) frequency, and PLL (VCO) frequency do not exceed their respective maximum or minimum operating frequencies. Refer to the PLL_CFG[0-3] signal description in the hardware specifications for valid PLL_CFG[0-3] settings.
- 2. Rise and fall times for the SYSCLK input are measured from 0.4 V to 2.4 V.
- ${\it 3. Timing is guaranteed by design and characterization, and is not tested.}\\$
- 4. Cycle-to-cycle jitter, and is guaranteed by design.
- 5. Relock timing is guaranteed by design and characterization, and is not tested. PLL-relock time is the maximum amount of time required for PLL lock after a stable Vdd and SYSCLK are reached during the power-on reset sequence. This specification also applies when the PLL has been disabled and subsequently re-enabled during sleep mode. Also note that HRESET must be held asserted for a minimum of 255 bus clocks after the PLL-relock time during the power-on reset sequence.

Ordering Information

The following table provides the ordering information for the PID6-603e part numbers described herein.

Ordering Information for the PowerPC 603e

Package Type	Device Rev	Process	Mask Code	CPU Frequency (MHz)	Motorola Part Number
240	4.1	PPC1.3	01H49P	100	MPC603EFE100LN
CQFP				133	MPC603EFE133LN
				100	MPE603EFE100LN
				133	MPE603EFE133LN
				100	MPC603EFE100TN
				133	MPC603EFE133TN
255	4.1	PPC1.3	71H49P	100	MPC603ERX100LN
CBGA				133	MPC603ERX133LN
				133	MPE603ERX133LN
				100	MPE603ERX100LN
				100	MPC603ERX100TN
				133	MPC603ERX133TN

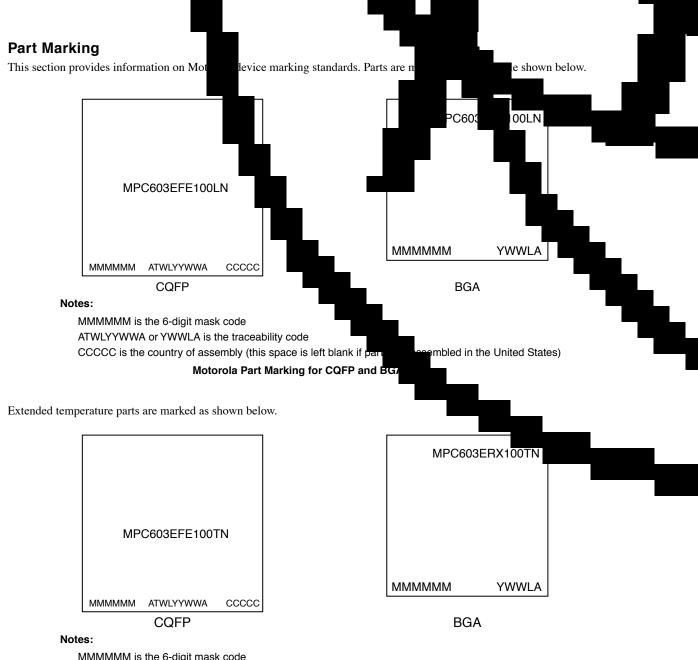

MMMMMM is the 6-digit mask code

ATWLYYWWA or YWWLA is the traceability code

CCCCC is the country of assembly (this space is left blank if parts are assembled in the United States)

Motorola Part Marking for Extended Temperature CQFP and BGA Devices

Information in this document is provided solely to enable system and software implementers to use PowerPC microprocessors. There are no express or implied copyright licenses granted hereunder to design or fabricate PowerPC integrated circuits or integrated circuits based on the information in this document.

Motorola reserves the right to make changes without further notice to any products herein. Motorola makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Motorola assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. "Typical" parameters can and do vary in different applications. All operating parameters, including "Typicals" must be validated for each customer application by customer's technical experts. Motorola does not convey any license under its patent rights nor the rights of others. Motorola products are not designed, intended, or authorized for use as components in systems intended for surgical implant into the body, or other applications intended to support or sustain life, or for any other application in which the failure of the Motorola product could create a situation where personal injury or death may occur. Should Buyer purchase or use Motorola products for any such unintended or unauthorized application, Buyer shall indemnify and hold Motorola and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable attorney fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Motorola was negligent regarding the design or manufacture of the part.

Motorola manufacture of the parts of Motorola products for any products of the part.

Motorola and (A) are registered trademarks of Motorola, Inc. Motorola, Inc. is an Equal Opportunity/Affirmative Action Employer.

IBM is a registered trademark of International Business Machines Corporation.

The PowerPC name is a registered trademark and the PowerPC logotype and PowerPC 603e are trademarks of International Busines Machines Corporation, used by Motorola under license from International Business Machines Corporation.

